CHANDELIER 5706BK TRIM DIAGRAM

THIS DESIGN IS THE PROPRIETARY
TRADE DRESS/TRADEMARK OF
SCHONBEK WORLDWIDE LIGHTING INC.

7 Lights
Diameter: 25"
Body Length: 38-1/2"

SCHONBEK®

This crystal chandelier was designed and manufactured in Plattsburgh, N.Y. Our high-quality crystal fixtures are made with state-of-the-art manufacturing equipment. If you have any questions about this or any of our more than 250 crystal products, contact your nearest authorized Schonbek distributor.

CAUTION... RISK OF ELECTRICAL SHOCK. Make sure the electrical supply to the chandelier is turned off at the main fuse or circuit breaker before doing any installation. All electrical components must be installed by a licensed electrician in accordance with the National Electric Code and the appropriate local electrical codes.

HANGING WEIGHT: 32 pounds.

BULBS: 7   Candle shaped candelabra base C10 bulbs, recommend 25 watts for best appearance.
        60   Watt Maximum

WARNING: This chandelier meets UL/CSA requirements. Any tampering will void UL/CSA certification.

MAINTENANCE:

Use a damp chamois to clean the glass frame.

UNDER NO CIRCUMSTANCES SHOULD METAL POLISHES, CLEANERS, ABRASIVES OR AEROSOL SPRAYS BE USED.

While the latest finishing techniques have been used on the metal frame, such finish cannot be unconditionally guaranteed. The main cause of deterioration, apart from certain atmospheric conditions, is improper cleaning.

To clean the crystals, polish with a soft, damp chamois.

You are cleaning delicate crystal... Take the greatest care.

IMPORTANT:

Do not clean crystals in a dishwasher. The finish of the metal clips and hangers will be ruined and the crystals may be damaged.


IMPORTANT
*Please record the following information
for future service.*

CODE   # _____   Four-digit number on
                        outside of carton.
PACKER   # _____   See crystal package label.
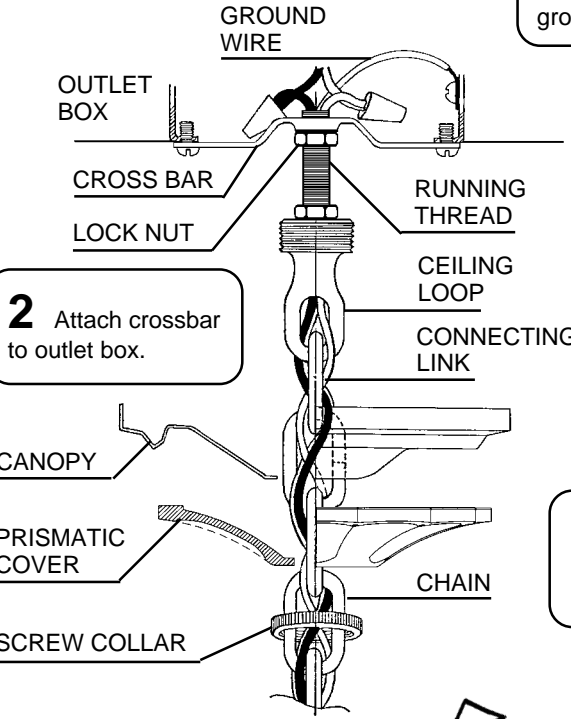ORDER   # _____   See crystal package label.

CAUTION: Glass parts are fragile. COLOR ➔
To avoid breakage use care when
assembling or cleaning.

*WHEN ORDERING REPLACEMENT
ARM(S):*
● Give arm number from trim diagram
● Give color code from the arm itself

1 **MAKE SURE THAT POWER TO THE OUTLET BOX IS DISCONNECTED!!**
IMPORTANT:
NEUTRAL WIRE IS WHITE
GROUND WIRE IS BARE OR GREEN

GROUND WIRE

OUTLET BOX

CROSS BAR

LOCK NUT

RUNNING THREAD

CEILING LOOP

CONNECTING LINK

2 Attach crossbar to outlet box.
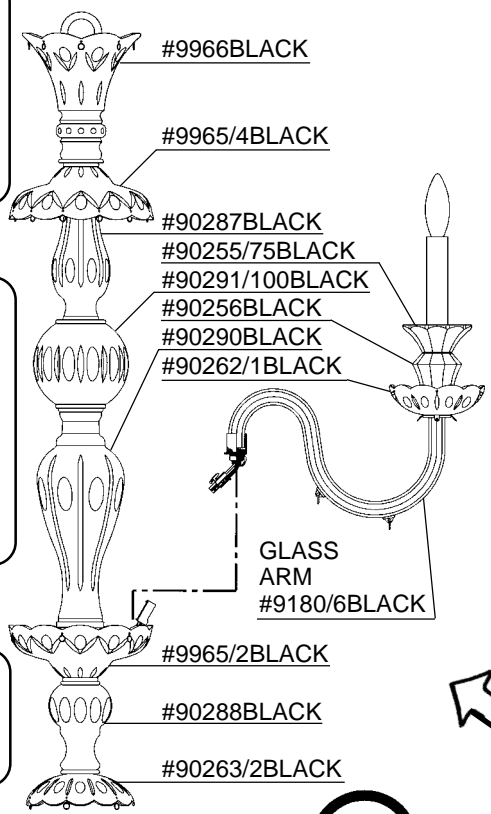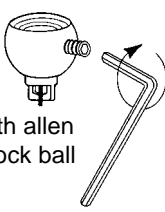
CANOPY

PRISMATIC COVER

CHAIN

SCREW COLLAR

3 Slip screw collar, prismatic cover and metal canopy over chain. Determine the suspension length of the fixture and cut chain, if necessary. Use two connecting links to attach chain to chandelier loop and ceiling loop.

SCHONBEK IS A WORLD LEADER IN CHANDELIER DESIGN.
PATENTS INCLUDE:
#D5,873,652

4 Insert stem wire through chain and ceiling loop. Connect wires in outlet box. Fixture MUST be grounded.

5 Check distance from ceiling to loop to assure canopy assembly will be flush against ceiling.

6 Attach canopy to ceiling with screw collar.

#9966BLACK

#9965/4BLACK

#90287BLACK
#90255/75BLACK
#90291/100BLACK
#90256BLACK
#90290BLACK
#90262/1BLACK

GLASS ARM
#9180/6BLACK

#9965/2BLACK

#90288BLACK

#90263/2BLACK

7 Connect arm wires to the center column using plug-in connectors. See detailed illustration.

8 Push wires into hole and attach arm to washer by rotating arm into place. Lock down by tighting screws into flange. See detailed illustration.

9 Install bobeches, bulbs, connect power and test the fixture before trimming. If any of the bulbs do NOT light - DISCONNECT POWER. Double check the wire connections.

C ℞ US

COLUMN DISH #1

A

COLUMN DISH #2

B

C

COLUMN DISH #3

COLUMN DISH #4

F

A

E

10 Hook Crystal "A" into ring on the column dish #1.

11 Hook Chain "C" into every other ring on the column dish #2. (NOTE: Make sure Chains "C" hang in between arms.) Hook Chain "D" into the loops of Chain "C". Hook the other ends of Chain "D" into the back tab under the bobeche on the arms.

12 Hook Crystal "B" into every other ring on the column dish #2.

13 Screw Crystal Ball "E" onto the bottom of the frame. Tighten set screw with allen wrench provided to lock ball into position.

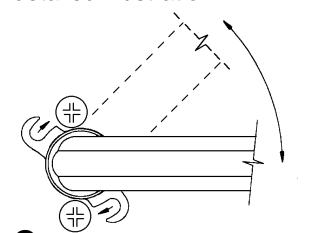**14** Hook Crystal "A" into rings on the column dish #4.

15 Hook Crystal "F" into ring on the column dish #3.

D

K

A

J

H

G

19 Hook Crystal "A" into ring on bobeche.

16 Hook Crystal "G" into the inside rings on the lower arm. Hook Crystal "H" into the outside rings on the lower arm.

17 Hook Crystal "J" into the front tab under the bobeche on the arm.

18 Hook Chain "K" into the side tab under the bobeche on the arm. Chain "K" swags between arms.

5706BK