

ASSEMBLY INSTRUCTIONS FOR YOUR BEEHIVE PENDANT

IMPORTANT SAFETY INSTRUCTIONS:

*These instructions are provided for your safety. It is very important that they are read completely before beginning the installation of your fixture.


*DIRECT WIRE FIXTURES: WE STRONGLY RECOMMEND INSTALLATION BY A LICENSED ELECTRICIAN.

WARNING:

*Turn the power to fixture off before replacing bulbs, making sure the bulbs have had sufficient time to cool down. Do not subject the fixture to any shock while lit as shattering of bulbs may result.

ASSEMBLY INSTRUCTIONS:

1. SHUT OFF THE MAIN ELECTRICAL SUPPLY FROM THE MAIN FUSE BOX/ CIRCUIT BREAKER.
2. Remove all parts from carton. Do not throw away any parts.
3. Remove cross bar (A) from threaded nipple (D), and canopy (C). Affix cross bar (A) to "J BOX" using screws (B) provided.
4. Remove quick connector (E) from loop on threaded nipple (D) and top loop of chain (F).
5. Measure desired drop for fixture to hang and add / remove chain links (F) with chain break tool (not included). Once desired drop is reached, guide wiring up through chain links (F).
6. Thread wiring through center hole in threaded nipple (D).
7. Thread wiring through center hole in canopy (C).
8. Lift fixture to "J BOX", and thread wiring through hole in crossbar (A). Make proper electrical connection. A LICENSED ELECTRICIAN IS RECOMMENDED.
9. Connect the ground wire (green or copper) from the fixture to the ground wire in the outlet box. Connect the black wire of the fixture (or smooth side of the wire) to the black wire in outlet box using wire nut (G). Tightly wrap connection with electrical tape. Connect the white wire of the fixture (or rough side of the wire) to the white wire in outlet box using wire nut (G). Tightly wrap connection with electrical tape.
10. Hold canopy against ceiling over "J BOX". Slide threaded nipple (D) through canopy (C) and thread into hole in center of crossbar (A). Turn until collar on threaded nipple (D) holds canopy securely against ceiling.
11. Attach quick connector (E) to loop on threaded nipple (D) and top loop of chain (F).
12. Install three (3) B11 60W max torepedo bulbs into sockets (I).
13. Align holes in glass shade (L) with holes in bottom section of shade canopy (J). Place bottom section of shade canopy (J) over top opening of glass shade (L). Carefully thread shade screws (K) through holes in bottom section of shade canopy (J) and glass shade (L).
14. Carefully move glass shade (L) over sockets (K), and insert hooks (H) into holes in top section of shade canopy (J). (DO NOT ATTACH SHADE UNLESS POWER TO FIXTURE IS OFF.)

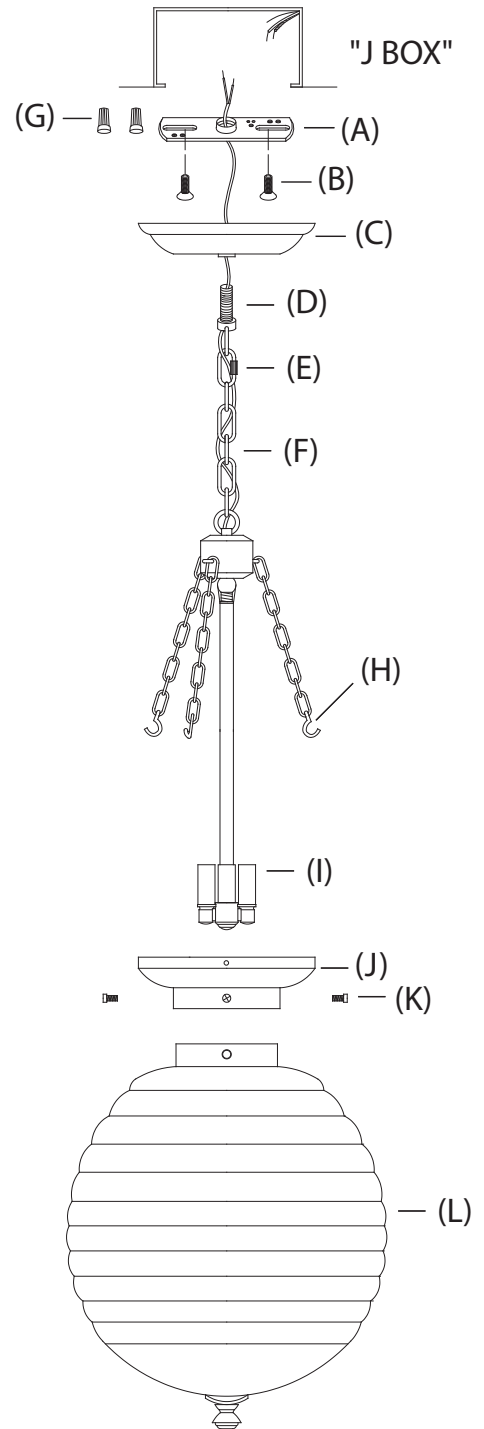

CARE INSTRUCTIONS:

*To clean, use a soft cloth only. DO NOT use any chemical or abrasive cleaners.