


Important: Label on back contains important information on your crystal. Please save in case you ever need to order matching crystal.

Piagram Diagram Pendant RE0409A




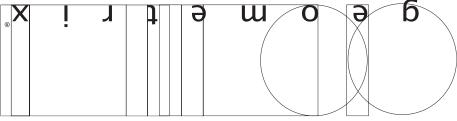


Schonbek Worldwide Lighting Inc., 61 Industrial Blvd., Plattsburgh NY 12901-1908
Tel: 800.836.1892 or 518.563.7500 www.schonbek.com

© 2006 SCHONBEK WORLDWIDE LIGHTING INC., A. SCHONBEK & CO. LTD. WORLDWIDE COPYRIGHT RESERVED

US PATENT: #5,109,325

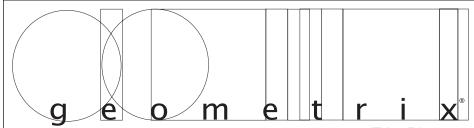

Trim Diagram Refrax[™] Pendant RE0409A

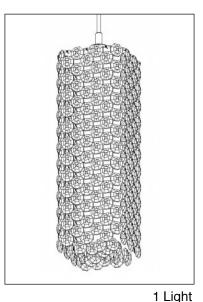

Length: 4", Width: 4", Height: 9"

Geometrix[™] is designed by Schonbek with Swarovski Spectra® crystal.


SPECTRA Swarovski Crystal

This design is the proprietary trade dress/trademark of Schonbek Worldwide Lighting Inc.


Please save your trim diagram for future reference.

IMPORTANT: Label on back contains important information on your crystal. Please save in case you ever need to order matching crystal.



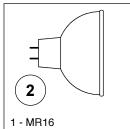

1 - MR16 (Wide Flood) 35 Watts Recommended (supplied - Schonbek # : MR16-FMW-G) 50 Watts Max.

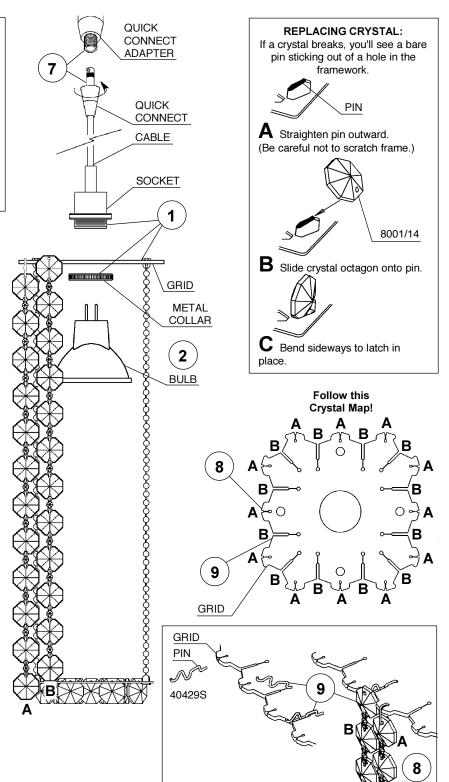




How to Install MR16 Bulb and Refrax[™] Pendant:

Pendants may be mounted to monorail systems, monopoints or line voltage track by coupling to the quick connect transformer adapter. Attached to the socket is a cable that may be cut on site during installation to any length (see instructions below).


1 Position the pendant grid against the socket and secure in place by screwing the metal collar onto the socket.

2 Plug bulb carefully but completely into socket. Use only an MR16 glass covered lamp bulb.


How to Shorten the Cable:

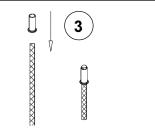


3 Cut the cable cleanly with wire cutter to desired length, and slide brass collar over wire. Position collar so that a small section (1/16") of braided wire protrudes from the top of the collar.

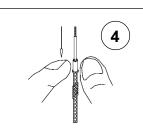

4 Grasping the collar, slide braided outer wire back to expose inner wire. Trim 1/8" of insulation from the inner wire with wire stripper.

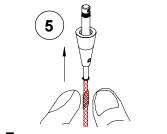

5 Feed inner wire into quick connect adapter until it reaches top set screw. Feed braided outer wire and brass collar into quick connect.

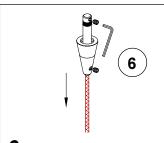

6 Tighten top set screw first, then lower set screw snugly. Smooth out any bulges in braided wire.

7 Screw quick connect into quick connect adapter until it seats. If you adjust the orientation of the pendant, be careful not to loosen the connection.

8 Hang A chains first, following the crystal map. Hook the connectors into the pinholes located towards the outside of the grid. See illustration to the left.

9 Insert pins into grid. Hang B chains by sliding the octagon with an open hole onto the pin. Chains B will nest into position between A chains. See illustration to the left.