
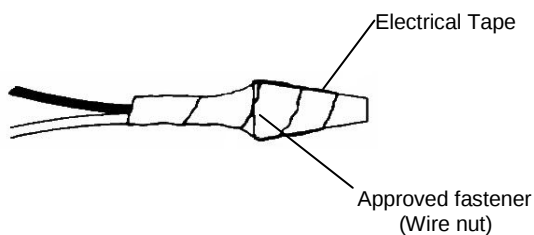
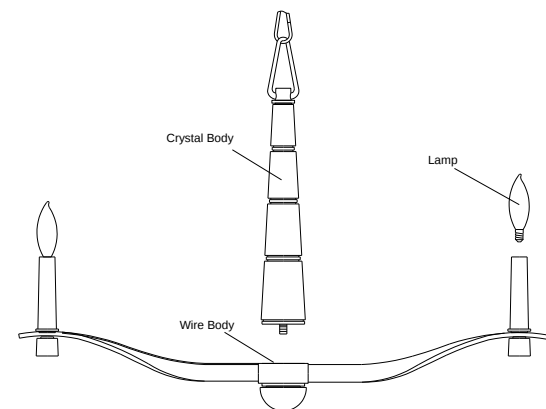


6158 & 6158

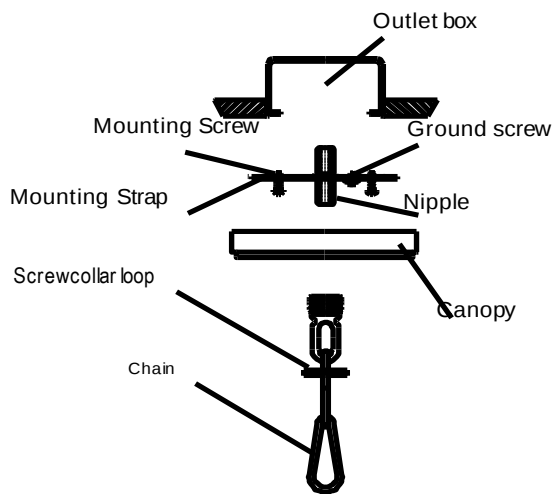

Hudson Valley Lighting, Inc.
P.O. Box 7459
106 Pierces Road
Newburgh, NY 12550
(800) 814-3993
www.hudsonvalleylighting.com

GENERAL

1. To ensure the success of the fixture installation, the following instructions and diagram(s) should be read and understood.
2. All electrical connections must be made in accordance with the National Electric code and local codes and ordinances. If you are uncertain of the methods of installing electrical wiring and lighting fixtures secure the services of a qualified licensed electrician.

3. TOOLS NEEDED: Blade screwdriver, phillips screwdriver, slip joint pliers or small adjustable wrench, wire cutter/stripper, electrical current tester, stepladder and electrical tape. NOTE: The important safeguards and instructions outlined on this sheet are not meant to cover all possible conditions and situations that may occur. It must be understood that common sense, caution and care are factors that cannot be built into any product. Caution and care must be supplied by the person(s) installing, operating and maintaining this lighting fixture.

INSTALLATION PREPARATION




1. **TURN OFF THE ENTIRE ELECTRICAL CIRCUIT TO WHICH THE LIGHTING FIXTURE IS TO BE ATTACHED.** Move the appropriate circuit breaker to the "off" position or completely remove the fuse controlling the circuit.
2. If an existing fixture is being replaced, remove it and note to which of the wires in the outlet box the fixture was attached. **DO NOT SEPARATE ANY OTHER WIRES THAT MAY BE IN THE BOX. DO NOT DAMAGE THE INSULATION OF OLDER WIRING.** In regular circumstances the BLACK wire will be the "Hot" lead and the WHITE wire will be the "Neutral" or "Common" lead. A GREEN or BARE COPPER wire is the "Ground". In older buildings it is always good practice to reconfirm the polarity of the wiring.
3. This fixture is designed to be mounted on a standard round or octagon box. The box must be securely mounted to the structure of the building.

FIXTURE INSTALLATION

1. Remove the fixture, shades and parts bag(s) from the carton. Before discarding the carton, double check packing to make certain that all parts are found.
 2. Assemble the center column and loop assembly to the fixture body.
 3. Attach the mounting strap to the outlet box. (The green screw should face the floor).
 4. Thread the nipple onto the mounting strap.
 5. Measure 6" of lead wire beyond the end of the chain. Cut off the excess wire. Strip the insulation off the ends of the leads exposing approx. 1/2" wire. Twist the strands of wire together. Push the leads and ground wire up through the screwcollar loop and nipple and into the outlet box.
 6. Fasten the green fixture wire to the green or bare copper wire in the box or fasten it to the mounting plate with green screw provided.
NEVER FASTEN THE GROUND WIRE TO THE BLACK OR "HOT" WIRE! FAILURE TO FOLLOW THIS INSTRUCTION COULD RESULT IN SERIOUS INJURY OR DEATH!
 7. Fasten the white fixture wire to the white wire in the outlet box. Fasten the wires to together with an approved fastener (wire nut). Starting about 1" below the fastener, tightly wrap connection with electrical tape so that the tape seals the end of the fastener. Make sure that there is no exposed wire or strands that could cause a dangerous short circuit !
 8. Connect the black fixture wires to the black wire in the outlet box. Fasten the joined wires as in step 7.
 9. Slide the canopy and screwcollar ring up the chain and secure the canopy to the ceiling.
 10. Twist the crystal body onto the wire box.
 11. Open end links of chain and attach the chain to the loop. Close the top link of the chain. Hang the fixture on the chain at the desired height. Remove the excess chain. Close the bottom link of the chain.
 10. Install the lamps.
- NOTE:** This fixture is rated for 60 watt type B or C lamp.
DO NOT EXCEED RECOMMENDED WATTAGE !
11. Restore power to circuit at breaker or fuse box.

INSTRUÇÕES DE INSTALAÇÃO

6155 & 6158

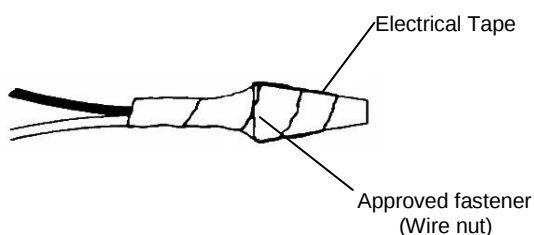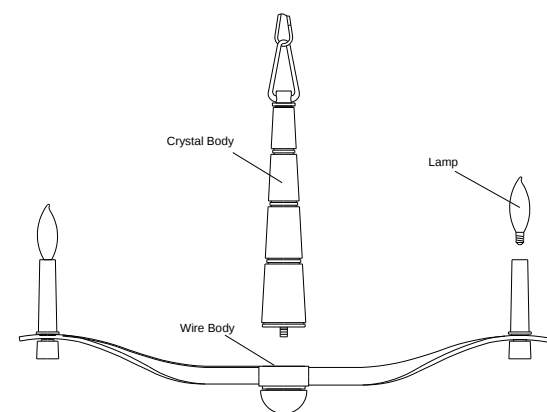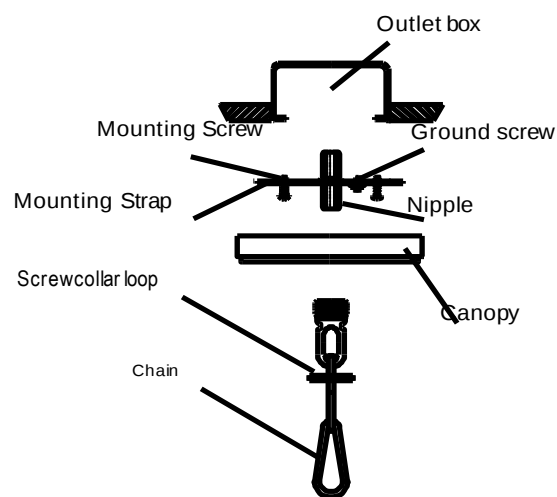

Hudson Valley Lighting, Inc.
P.O. Box 7459
106 Pierces Road
Newburgh, NY 12550
(800) 814-3993
www.hudsonvalleylighting.com

GERAL

1. Para garantir o sucesso da instalação do dispositivo elétrico, as instruções a seguir e esquema (s) deve ser lido e compreendido.
2. Todas as ligações elétricas devem ser feitas de acordo com o National Electric código e códigos locais e ordenanças. Se você não tiver certeza dos métodos de Instalar fiação elétrica e dispositivos elétricos de iluminação assegurar os serviços de um qualificado eletricitista licenciada.
3. Ferramentas necessária: Chave de fenda de lâmina, chave de fenda phillips, alicate comum de deslizamento ou pequena chave inglesa ajustável, fio cortador/stripper, testador de corrente elétrica, escada e fita isolante. Nota: As salvaguardas importantes e instruções descritas na Esta folha não se destinam a cobrir todas as possíveis condições e situações que podem ocorra. Ele deve ser entendido que o senso comum, cuidado e cuidado são fatores que não pode ser construído em qualquer produto. Cautela e cuidados devem ser fornecidos pelo pessoa (s) instalar, operar e manter este aparelho de iluminação.

PREPARAÇÃO PARA INSTALAÇÃO

1. DESLIGUE O CIRCUITO ELÉTRICO DE TODO PARA QUE A ILUMINAÇÃO DISPOSITIVO ELÉTRICO É SER ANEXADO. Mover o disjuntor apropriado para o "fora posicionar ou remover completamente o fusível controlando o circuito.
2. Se um dispositivo elétrico existente está sendo substituído, remova-o e Observe que os fios na caixa de saída do dispositivo elétrico foi anexado. NÃO SEPARE QUALQUER OUTRO FIOS QUE PODEM SER NA CAIXA. NÃO DANIFIQUE O ISOLAMENTO DO CABOS MAIS ANTIGOS. Em circunstâncias normais o fio preto será a liderança "Quente" e o fio branco vai ser "Neutro" ou "Comum" de chumbo. Um verde ou BARE Fio de cobre é o "solo". Em edifícios mais antigos é sempre boa prática Reconfirme a polaridade da fiação.
3. Este acessório é projetado para ser montado em uma caixa redonda ou octagon padrão. O caixa deve ser montada de forma segura para a estrutura do edifício.

INSTALAÇÃO DE DISPOSITIVO ELÉTRICO

1. Remova substituída dispositivo elétrico, tons e partes da embalagem. Antes de descartar a embalagem, verificação dupla embalagem para certificar de que todas as peças são encontradas.
 2. Monte a centro coluna e loop de montagem para o corpo do dispositivo elétrico.
 3. Anexe a precinta de montagem da caixa de saída. (O parafuso verde deve enfrentar o piso).
 4. O mamilo para a cinta de montagem de thread.
 5. Medida 6 "de fios de chumbo para além do fim da cadeia. Corte o fio excedente. Tira o isolamento fora as extremidades de leads expondo aprox. ½ "fio. Torcer o cordões de arame junto. Empurre os leads e terra fio através da screwcollar loop e mamilo e na caixa de saída.
 6. Prenda o fio verde acessório para o fio de cobre verde ou desencapado na caixa ou Prenda-a placa de montagem com parafuso verde fornecido. **NUNCA PRENDA O FIO DE TERRA PARA O PRETO OU FIO "QUENTE"!** NÃO SEGUIR ESTA INSTRUÇÃO PODE RESULTAR EM GRAVES LESÃO OU MORTE!
 7. Prenda o fio branco acessório para o fio branco na caixa de saída. Prenda os fios para juntos com um fixador aprovado (porca do fio). Começando aproximadamente 1 "abaixo o fixador, rigidamente quebrar conexão com fita isolante tão que a fita sela o fim do fixador. Certifique-se de que não há fios expostos ou vertentes que poderiam causar um perigoso curto-circuito!
 8. Conecte os fios do dispositivo elétrico preto para o fio preto na caixa de saída. Prenda os fios ingressou como na etapa 7.
 9. Deslize o anel de dossel e screwcollar na cadeia e proteger o dossel para o limite máximo.
 10. Torção do corpo de cristal para a caixa de fio.
 11. Abrir links de fim de cadeia e anexar a cadeia para o loop. Fechar o top link da cadeia. Pendure a fixação da cadeia na altura desejada. Remover da Cadeia de excessiva. Feche a ligação inferior da cadeia.
 10. Instale as lâmpadas.
- Nota: Este acessório é classificado para lâmpada de tipo b ou c de 60 watts. **NÃO EXCEDAM POTÊNCIA RECOMENDADA!**
11. Restauração do poder ao circuito no separador ou caixa de fusíveis